2015 Asbestos Survey
Ref: Zer/st/ry/11
Location Ref:AS04
Location: Ground Outside Shed 2

Asbestos Information		**Inspection Number:**	**Zer/st/ry/11**
Site Reference	**Zer/st/ry/2015**	**Client Name**	**South Tynedale Railway**
Address	South Tynedale Railway, Alston, CA9 3JB		

Level/Floor	Ground (Shed 2)
Room/Area	External Areas
Element	Drain Pipes (Front & Rear)
Inspection Method	Sample Taken
Inspection Date	17th July 2015
Material Assessment	
Product Type	Non Friable Material
Extent of Damage	Medium Damage
Surface Treatment	Cement/Enclosed Spray or Lagging/Sealed Board
Overall Asbestos Type	Chrysotile
Material Assessment	**5.0**
Priority Assessment	
Occupant Activity	Low Disturbance
Disturbance (Accessibility)	Easily Disturbed
Disturbance (Extent)	Less Than 10m2 or 10 lm
Disturbance (Location)	Outdoors
Exposure (Usage Time)	Less than 1 hour
Exposure (Freq. of Use)	Infrequent
Exposure (No. of Occupants)	None
Maintenance (Freq. Of)	Less Than Once per Year
Maintenance (Type Of)	Low Disturbance
Priority Assessment	**3.0**

Total Risk Assessment		**Recommendation:**	**Remove if impacted by refurbishments**
Score	**8.0**	**Score Category**	**Very Low Risk**

35

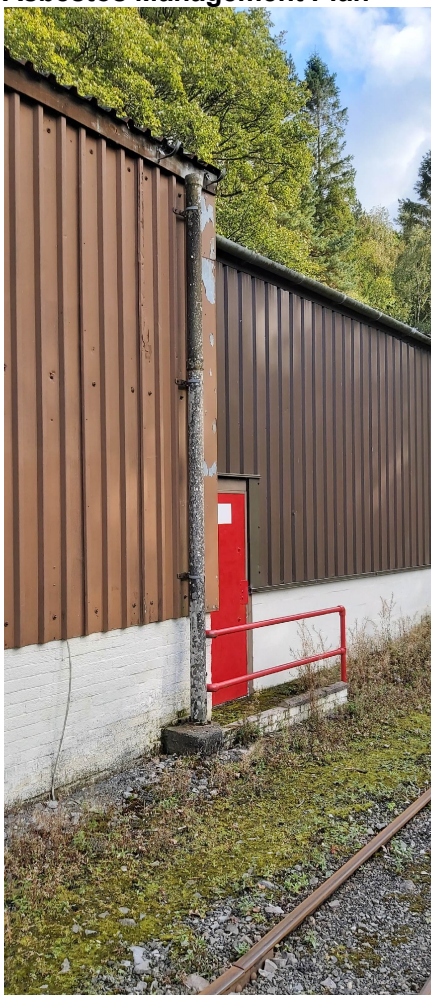

2020 Asbestos Survey – Photograph – Ref: Zer/st/ry/11
Location Ref: AS05
Location: Ground Outside Shed 2

2015 Asbestos Survey
Ref: Zer/st/ry/12
Location Ref: AS05
Location: Outside Shed 2

Asbestos Information		**Inspection Number:**	**Zer/st/ry/12**
Site Reference	**Zer/st/ry/2015**	**Client Name**	**South Tynedale Railway**
Address	South Tynedale Railway, Alston, CA9 3JB		

Level/Floor	Ground (Shed 2)
Room/Area	External Areas
Element	Damp Proof Course
Inspection Method	Sample Taken
Inspection Date	17th July 2015
Material Assessment	
Product Type	Non Friable Material
Extent of Damage	Low Damage
Surface Treatment	Reinforced Composite Material
Overall Asbestos Type	Chrysotile
Material Assessment	**3.0**
Priority Assessment	
Occupant Activity	Rare Disturbance
Disturbance (Accessibility)	Normally Inaccessible
Disturbance (Extent)	More Than 50 m2 or 50 lm
Disturbance (Location)	Outdoors
Exposure (Usage Time)	Less than 1 hour
Exposure (Freq. of Use)	Infrequent
Exposure (No. of Occupants)	None
Maintenance (Freq. Of)	Less Than Once per Year
Maintenance (Type Of)	Low Disturbance
Priority Assessment	**2.0**

Total Risk Assessment		Recommendation:	Remove if impacted by refurbishments
Score	**5.0**	**Score Category**	**Very Low Risk**

36

2020 Asbestos Survey
Ref: Zer/st/ry/12
Location Ref AS05
Location: Outside Shed 2

2015 Asbestos Survey
Ref: Zer/st/ry/13
Location Ref: AS06
Location:
Debris on Ground Outside Shed 2

Asbestos Information		**Inspection Number:**	**Zer/st/ry/13**
Site Reference	**Zer/st/ry/2015**	**Client Name**	**South Tynedale Railway**
Address	South Tynedale Railway, Alston, CA9 3JB		

Level/Floor	Ground (Shed 2)
Room/Area	External Areas
Element	Debris
Inspection Method	Sample Taken
Inspection Date	17th July 2015
Material Assessment	
Product Type	Non Friable Material
Extent of Damage	High Damage
Surface Treatment	Cement/Enclosed Spray or Lagging/Sealed Board
Overall Asbestos Type	Chrysotile
Material Assessment	**6.0**
Priority Assessment	
Occupant Activity	Low Disturbance
Disturbance (Accessibility)	Easily Disturbed
Disturbance (Extent)	Less Than 10m2 or 10 lm
Disturbance (Location)	Outdoors
Exposure (Usage Time)	Less than 1 hour
Exposure (Freq. of Use)	Infrequent
Exposure (No. of Occupants)	None
Maintenance (Freq. Of)	Less Than Once per Year
Maintenance (Type Of)	Low Disturbance
Priority Assessment	**3.0**

Total Risk Assessment		**Recommendation:**	**Remove**
Score	**9.0**	**Score Category**	**Very Low Risk**

37